

Smart-URG Pro

Scanning Laser Range Finder UST-30LC



RoHS



1. General

UST-30LC is a sensor which scans a 270° field using a laser beam (λ = 905 nm), then calculates coordinates by measuring the distance to an object and its corresponding step angle (LX mode) and detects obstacles within the setting area (LA mode). Only LX mode supports the multi echo data output. In LA mode, selected single echo output data is available. The desired mode (LX or LA) can be selected in the configuration application.

1-2. Area configuration

The user can configure areas in the sensor using application software provided by the manufacturer. Install the software in a supported operating system and connect the sensor using an Ethernet cable. See section 7 for details on types of area configuration.

1-3. Area switching


The sensor has 5 external inputs for switching the area. Provide the correct signal states on these inputs (see Table 1) to switch the area. There are modes 1 and 2 in LA mode. Use mode 2 when using the motor synchronization function. However, the number of areas that can be set will decrease.

1-4. Malfunction output

The sensor has a self-diagnostic function. It switches the malfunction output to an OFF state when errors are detected in the internal components.

2. Structure

2-1. Structure Diagram

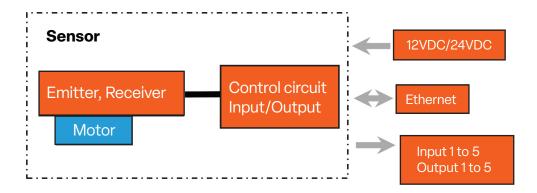




2.2 Laser Scanning Image

Measurement steps 2161

Detection angle 270°

Angular resolution 0.125°

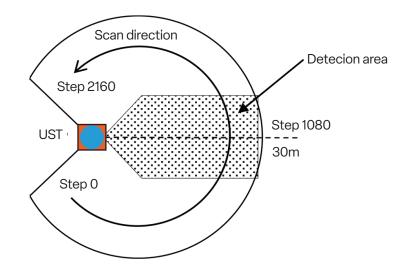

3. Important notes

- 1. This sensor is not a safety device/tool.
- 2. This sensor cannot be used for human body detection as per the machinery directives.
- 3. Hokuyo products are not developed and manufactured for the use in weapons, equipments or related technologies intended for destroying human lives or causing mass destruction. If such possibilities or usages are revealed, the sales of Hokuyo products to those customers might be halted by the laws of Japan such as Foreign Exchange Law, Foreign Trade Law or Export Trade control order. In addition, Hokuyo products are for the purpose of maintaining the global peace and security in accordance with the above law of Japan.
- 4. Sensor emits laser for measurement. Sensor's operation may become unstable under the influence of strong interference light or when emitted lights are not reflected back from the object.
- 5. Sensor's operation may become unstable due to rain, snow and fog or due to dust pollution on the optical window.
- 6. Rules and regulations related to safety should be followed strictly when machine users and system designers operates the sensor.
- 7. Before using the sensor, please read carefully and understand this specification.





3. Product Specs

Product Name	Scanning Laser Range Finder		
Model	UST-30LC		
Supply voltage	12VDC/24VDC (operation range 10 to 30V ripple within 10%)		
Supply current(*1)	150mA or less (when using DC24V) (during start up 450mA is necessary.)		
Supply power	Less than 3.6 W(steady state)		
Light source	Laser semiconductor (905nm)		
Laser Safety	Class1 (IEC60825-1:2014)		
Detection range and object	0.05m to 30m(*2) (white kent sheet) 0.05m to 12m(*2) (diffuse reflectance 10%) Max. detection distance: 60m Min. detection size: 90mm(10m), 180mm(20m), 260mm(30m)		
Accuracy	±40mm (*2)		
Repeated accuracy	σ< 20mm (*2)		
Scan angle	270°		
Scan speed(*3)	25msec (motor speed 2400rpm)		
Angular resolution	0.125°		
Start up time	Within 10 sec (start up time differs if malfunction is detected during start up)		
Outputs	Photo-coupler, open collector output Max DC 30V 50mA Output 1: Output 1 OFF during object detection Output 2: Output 2 OFF during object detection Output 3: Output 3 OFF during object detection Malfunction output: ON during normal operation, OFF during malfunction Synchronous output: Synchronization signal during Master/Slave operation. Note: Output 1 to 3 are switched OFF during malfunction state		
Inputs	Photo-coupler, common cathode, power supply is 4mA when input is ON Input 1 to 5: Area switching inputs (refer Table1)		
Output response time (*4)	OFF 66msec to 3241msec		
	ON 66msec to 3241msec		
Interface	Ethernet 100BASE-TX		
LED display	LX mode Power supply LED display (blue): Blinks during start up and malfunction state. LA mode Blue LED: ON during normal operation, blink during the start up, configuration and malfunction state Orange LED 1: Output 1 ON during object detection Orange LED 2: Output 2 ON during object detection Orange LED 3: Output 3 ON during object detection		
Synchronization function (*5)	Synchronization Master/Slave operation mode (can set by using Area Designer) Synchronization slave mode(0°) Synchronization slave mode(90°) Synchronization slave mode(180°) Synchronization slave mode(270°)		
Surrounding intensity	Less than 100,000lx Note: Avoid direct sunlight or other illumination sources as it may cause sensor malfunction		
Ambient temperature and humidity	-30°C to +50°C, below 85%RH (without dew, frost)		
Storage temperature and humidity	-30°C to +70°C, below 85%RH (without dew, frost)		
Vibration resistance	10 to 55Hz double amplitude of 1.5mm for 2hrs in each X, Y, and Z direction 55 to 200Hz 98m / s2 sweep of 2min for 1hr in each X,Y and Z direction		



UST-30LC

3. Product Specs (Continued)

Shock resistance	196m/s2 (20G) X,Y and Z direction each 10 times	
Insulation resistance	10ΜΩ	
EMC standards	(EMI) EN61326-1:2013 EN55011:2009 + A1:2010 (EMS) EN61326-1:2013 EN61000-4-2:2009 EN61000-4-3:2006 + A1:2008 + A2:2010 EN61000-4-4:2012 EN61000-4-6:2014 EN61000-4-8:2010	
RoHS	(EU)2015/863	
Protective Structure	IP67(*6)	
Weight	130g (excluding cable)	
Material	Front case: Polycarbonate, Rear case: Aluminum	
Dimensions(W×D×H)	50×50×70mm (sensor only)	

- (*1) Please use a power supply with enough current capacity.
- (*2) Under the factory standard testing conditions using white kent sheet. In the low temperature environment of -11°C or below, the detection distance will be the following: white kent sheet: 0.05m to 25m, diffuse reflectance 10%: 0.05m to 8m
- (*3) In the case of using a command other than MD,MS and ME. There is possibility of delay in response speed, due to surrounding environment.
- (*4) Initial setting is 66msec. ON/OFF delay function switching is possible by Area Designer. Response time can be further delayed by a maximum of 1scan during the area switching.
- (*5) Initial setting is synchronization master. When using synchronization operation, refer to section 9 for details about synchronization wiring. Synchronization slave setting is possible using Area Designer.
- (*6) The protective structure of Ethernet and Power connector is not IP67.



Table 1: Input states and corresponding area number

[Input 1]	[Input 2]	[Input 3]	[Input 4]	[Input 5]	Area Number
ON	ON	ON	ON	ON	Laser off*1
OFF	ON	ON	ON	ON	Area 1
ON	OFF	ON	ON	ON	Area 2
OFF	OFF	ON	ON	ON	Area 3
ON	ON	OFF	ON	ON	Area 4
OFF	ON	OFF	ON	ON	Area 5
ON	OFF	OFF	ON	ON	Area 6
OFF	OFF	OFF	ON	ON	Area 7
ON	ON	ON	OFF	ON	Area 8
OFF	ON	ON	OFF	ON	Area 9
ON	OFF	ON	OFF	ON	Area 10
OFF	OFF	ON	OFF	ON	Area 11
ON	ON	OFF	OFF	ON	Area 12
OFF	ON	OFF	OFF	ON	Area 13
ON	OFF	OFF	OFF	ON	Area 14
OFF	OFF	OFF	OFF	ON	Area 15
ON	ON	ON	ON	OFF	Area 16
OFF	ON	ON	ON	OFF	Area 17
ON	OFF	ON	ON	OFF	Area 18
OFF	OFF	ON	ON	OFF	Area 19
ON	ON	OFF	ON	OFF	Area 20
OFF	ON	OFF	ON	OFF	Area 21
ON	OFF	OFF	ON	OFF	Area 22
OFF	OFF	OFF	ON	OFF	Area 23
ON	ON	ON	OFF	OFF	Area 24
OFF	ON	ON	OFF	OFF	Area 25
ON	OFF	ON	OFF	OFF	Area 26
OFF	OFF	ON	OFF	OFF	Area 27
ON	ON	OFF	OFF	OFF	Area 28
OFF	ON	OFF	OFF	OFF	Area 29
ON	OFF	OFF	OFF	OFF	Area 30
OFF	OFF	OFF	OFF	OFF	Area 31

^{*1:}Laser is switched off when all inputs (1 to 5) are ON.

^{*2:} When using the synchronization function in LA mode 2, the maximum area number will be 15.



5. Connection


5-1. Power source, I/O Cable


Connector: DF62B-24EP-2.2C(00) Hirose

Cable length: 1000mm


Keep the output wires open or connect to output "Com Output +" if not in use. Keep the input wires open or connect to output "Com Input -" if not in use.

The input and output directions are based on this product.





Short point 2:



Number	Color	Signal
1	Orange(Red short point 1)	+VIN (DC12V/DC24V)
2	Orange(Black short point 1)	-VIN
3	Gray(Red short point 1)	Output 1
4	Gray(Black short point 1)	Output 2
5	White(Red short point 1)	Output 3
6	White(Black short point 1)	Malfunction output
7	Yellow(Red short point 1)	Synchronous output
8	Yellow(Black short point 1)	COM Input -
9	Pink(Red short point 1)	COM Input +
10	Pink(Black short point 1)	Input 1
11	Orange(Red short point 2)	Input 2
12	Orange(Black short point 2)	Input 3
13	Gray(Red short point 2)	Input 4
14	Gray(Black short point 2)	Input 5/ Synchronous input
15	NC	NC
16	NC	NC
17	NC	NC
18	NC	NC
19	NC	NC
20	NC	NC
21	NC	NC
22	NC	NC
23	NC	NC
24	NC	NC


5-2. Ethernet cable

Cable length: 300mm

Color	Signal
White(Orange)	TX+
Orange	TX-
White(Green)	RX+
Green	RX-



6. LED Display

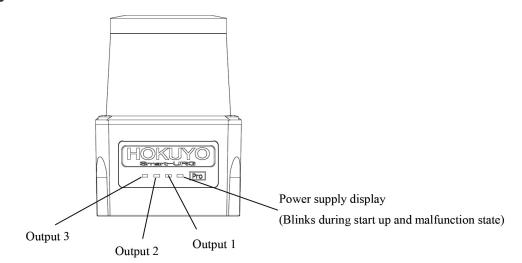

7. Area configuration

7-1 Normal configuration

In the normal configuration, the area for Output 1 is configured first and the shape of it can be configured freely. Areas for Output 2 and Output 3 are dependent on the set area of Output 1 and therefore they are configured inside it. The shapes of Output 2 and Output 3 areas can be straight, fan shape or ratio (Figure 1). Figure 2 and Table 2 show the relationship between the detected object position and the output states.


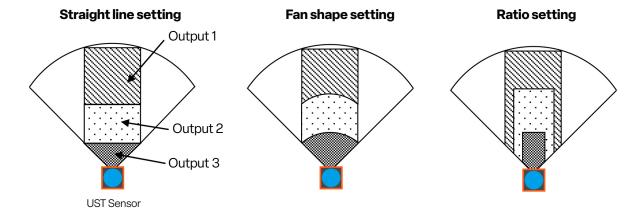


Figure 1: Normal area configuration



Object Position	Output 1	Output 2	Output 3
A	OFF	ON	ON
В	OFF	OFF	ON
С	OFF	OFF	OFF

Table 2: Relationship between object position and output states

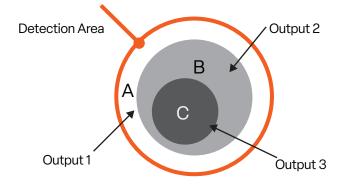

7-2. Independent configuration

In the independent configuration, areas for Output 1, Output 2 and Output 3 can be configured freely. The field covered by each output can be completely separate from the other output areas or there can be an overlapping region between the output areas Figure 3 (a) and (b).

Figure 4 and Table 3 show the relationship between the object position and the output states.

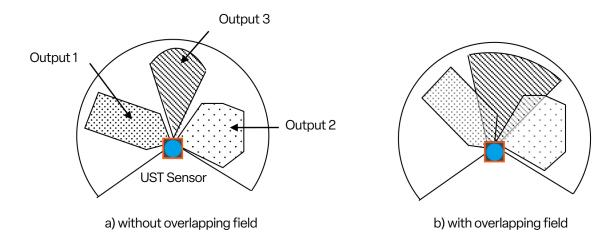


Figure 3: Independent area configuration

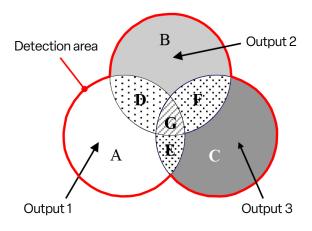


Figure 4: Output areas

Object Position	Output 1	Output 2	Output 3
Α	OFF	ON	ON
В	ON	OFF	ON
С	ON	ON	OFF
D	OFF	OFF	ON
E	OFF	ON	OFF
F	ON	OFF	OFF
G	OFF	OFF	OFF

Table 3: Relationship between object position and output area



8. Input/Output circuit connection example


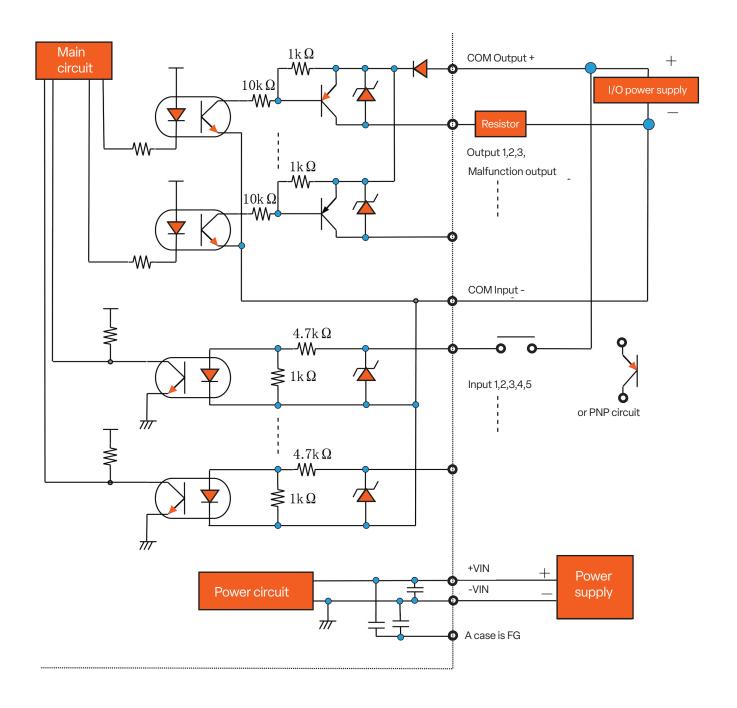


Figure 5: Connection example of inputs, outputs and power supply



9. The example of Synchronous wiring

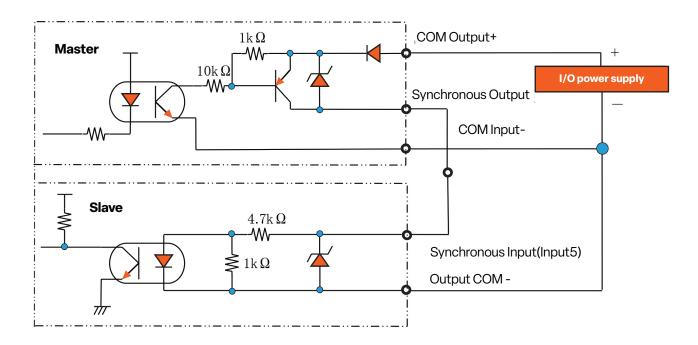

Note: This function is available in LA mode 2.


10. Measurement Data

Distance Value (x)	Meaning
x < 10	Output numerical number "65534" as Measurement error
10 <u><</u> x <u>≤</u> 60000	Valid distance [mm]
x>60000	Output numerical number "65533" as Measurement error (object does not exists or object has low reflectivity)

11. Control signal

11-1. Synchronous output

1 pulse is approximately 1ms. Output signal synchronization timing chart is shown as below.

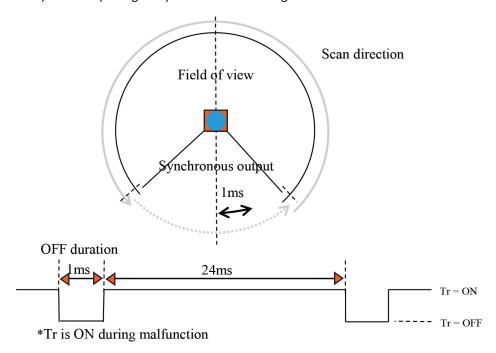

12. Multi-echo function

This sensor provides a maximum of three echoes (1st, 2nd, last) for each step (one direction). It also provides distance value and level value for each step. (For LX mode only)

Multiple echoes are generated when the laser beam is split by reflection on surface of transparent objects, reflection on object's edge and reflection from small particles such as rain, mist, dust and fog. Thus, distance and level value obtained from the multiple reflections in the same direction is called multi echo. However, if the distance between two object is too close or the object has low reflectance, the sensor may not detect it as multi echo.

13. Ethernet Setting

1. The setting value is as below. IP Initial value :192.168.0.10

Port number :100.40

Port number :10940

2. About changing IP address

It is possible to change and reset the IP address using a specialized application (IP Discovery). For details on installation and operation of IP Discovery, Please refer to IP discovery manual. (C-41-02603)

14. Cautions for operation

This sensor uses high speed processing components that generate heat during operation.

The heat is concentrated at the bottom of the unit. When mounting, please attach the bottom of the unit to a good heat sink. A 200mm x 200mm x 2mm aluminum plate is recommended as a heat sink.

If multiple sensors are installed side by side, a sensor may mistakenly accept the laser pulses of other units as its own thus causing a detection error. When it happens, usually the error lasts for one or two steps of measurement. Please use software filters to handle this type of error.







ISO14001 Certified JQA-EM3873

ISO9001 Certified JQA-1742

- Read instruction manual carefully before use.
- Products published in this brochure are intended to be used under specific conditions.
- For product related questions or technical issues, please contact our offices.



HOKUYO AUTOMATIC CO.,LTD.

Higobashi Union Building, 1-9-6 Edobori, Nishi-ku, Osaka-shi,Osaka, 550-0002 Japan TEL: +81-6-6441-2239 FAX: +81-6-6441-2204

URL: http://www.hokuyo-aut.jp E-mail: info@hokuyo-aut.jp

●EUROPE

HOKUYO AUTOMATIC CO., LTD. Amsterdam Branch Prof. J.H. Bavincklaan 2, 1183 AT Amstelveen, The Netherlands TEL: +31-20-240-0110

F-mail: info@hokuyo-aut.jp

● AMERICA

Hokuyo Automatic USA Corporation 2019 Van Buren Ave. Suite A, Indian Trail, North Carolina 28079 U.S.A. TEL: +1-704-882-3844

E-mail: sales@hokuyo-usa.com

●KOREA

HOKUYO KOREA CO., LTD. 104-211, 397 Seokcheon-Ro, Ojeong-Gu, Bucheon-City, Korea TEL: +82-32-624-3194

E-mail: hokuyokorea@naver.com